


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15786	Main Street: N_SHARON_AMITY_RD	Cross Street: AMITY_PL	Location: S
ADA ID: 8AD49FBAEBB0	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

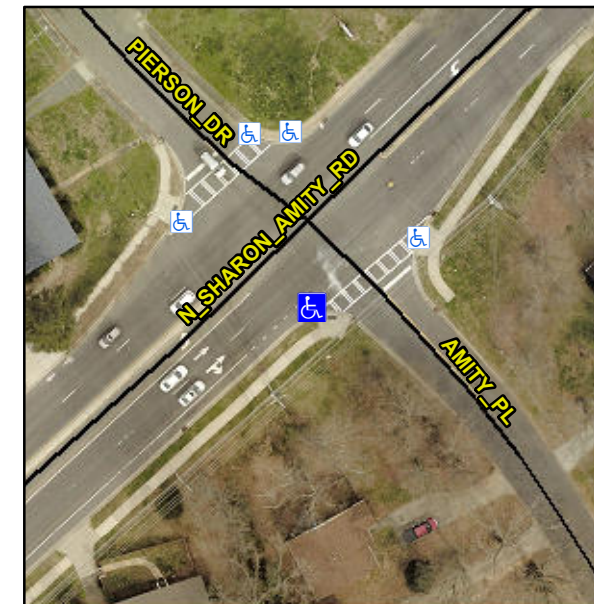

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

DWS WARPED

PROW/ADA:

R304.5.3, R305.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	67.0	Yes	BlendTrans Slope (%)	2.0
Yes	Ramp Width (in)	59.0	No	BlendTrans XSlope (%)	2.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	6.0	N/A	Flare Slope RT (%)	1.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	58.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
	X Walk 1 Width (in)	95.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	0.1
	X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	5.8
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9		Clear Space?	Yes
	Road X Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.7

