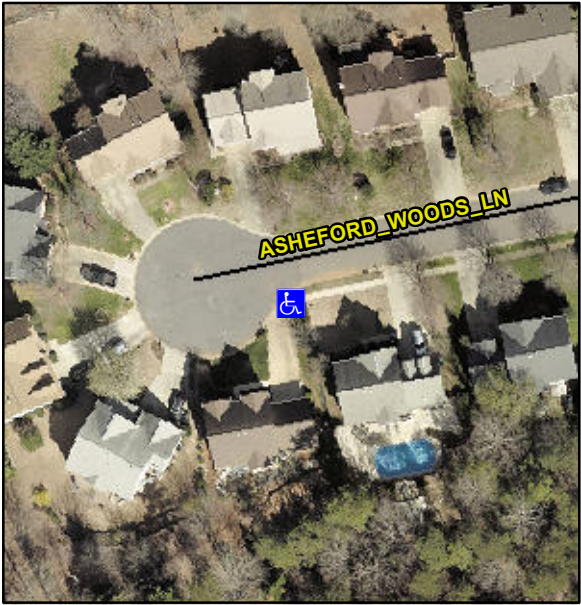


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10020058	Main Street: ASHEFORD_WOODS_LN	Cross Street: N/A	Location: SE
ADA ID: 8AFA9FD73AE1	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 10			

	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	60.0	Yes	Ramp Slope (%)	5.4
	Remove & Replace Gutter.	Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.8
		N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	6.2	Yes	Flare Slope RT (%)	5.8
		N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
		No	Landing Length (in)	34.5	No	DWS Provided?	No
		Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
		No	Landing Slope (%)	2.2	N/A	DWS Length (in)	N/A
		Yes	Landing X Slope (%)	0.3	N/A	DWS Full Width?	No
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R304.5.3</p>		N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	No			
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.7
		Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.2
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To N		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	3.3		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>			Road Slope (%)	N/A	N/A	Clear Space?	Yes
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	2600.00				

