


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|---|-------------------------------|---|------------------------|
| Intersection ID: 10033470 | Main Street: OLD_PINEVILLE_RD | Cross Street: N/A | Location: SW |
| ADA ID: 8B17A4B73648 | Ramp Type: Directional1 | Initial Pass/Fail: Pass | Overall Compliance: No |
| Severity Score: 7.5 | | | |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |

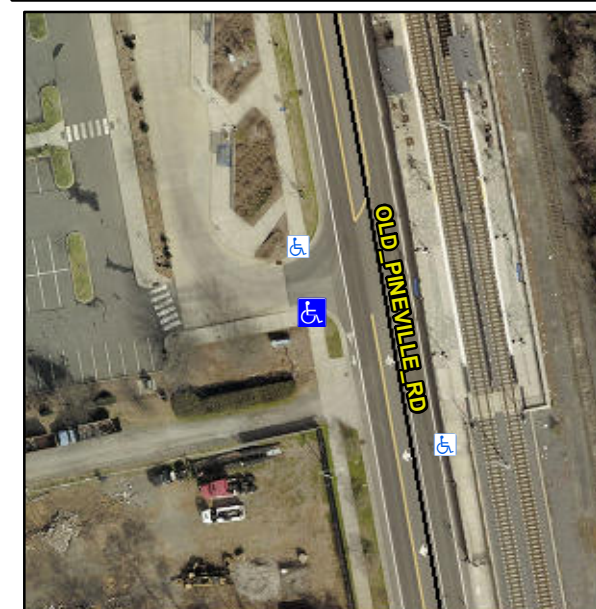

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R304.2.3, R305.1.4, R305.2,
R304.5.4**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 125.0 | Yes | Grade Break? | Yes |
| Yes | Ramp Width (in) | 96.0 | Yes | Grade Break Slope (%) | 2.7 |
| Yes | Ramp Slope (%) | 2.4 | Yes | Grade Break XSlope (%) | 1.7 |
| Yes | Ramp XSlope (%) | 1.7 | | | |
| Yes | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | No | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | Yes |
| Yes | Landing Length (in) | 60.5 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 97.5 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 1.5 | Yes | DWS Length (in) | 24.0 |
| No | Landing X Slope (%) | 2.6 | No | DWS Full Width? | No |
| N/A | Landing Curb? (Y/N) | No | No | DWS Offset LT (in) | 3.0 |
| N/A | Shared Landing? | No | Yes | DWS Offset RT (in) | 16.0 |
| Yes | Gutter Ponding? | No | No | Gutter Slope (%) | 6.5 |
| Yes | Gutter Lip Ht (in) | 0.0 | No | Gutter X Slope (%) | 2.2 |
| N/A | Painted X Walk1? | No | | Road Slope (%) | 2.3 |
| | X Walk 1 Direction | To N | | Road X Slope (%) | 0.9 |
| | X Walk 1 Width (in) | N/A | | Clear Space? | Yes |
| | X Walk 1 Slope (%) | 2.3 | N/A | Clear Space to XWalk (in) | N/A |
| | X Walk 1 X Slope (%) | 0.9 | Yes | Storm Grate/Utility Hazard? | No |
| N/A | Ramp inside XWalk1? | N/A | | Storm Grate/Utility Type | |
| Yes | Any Obstructions? | No | | | N/A |
| | Obstruction Type | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 6.3 |

Total Cost: \$ 2350.00

| | |
|-------------------------|----------|
| Street 1 Name | ENTRANCE |
| Stop Condition-Street 1 | None |
| Street 2 Name | N/A |
| Stop Condition-Street 2 | N/A |

