

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 6170	Main Street: OAKBLUFF_CR	Cross Street: TIMBERBLUFF_DR	Location: SW
ADA ID: 8B1FB4A6CD94	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

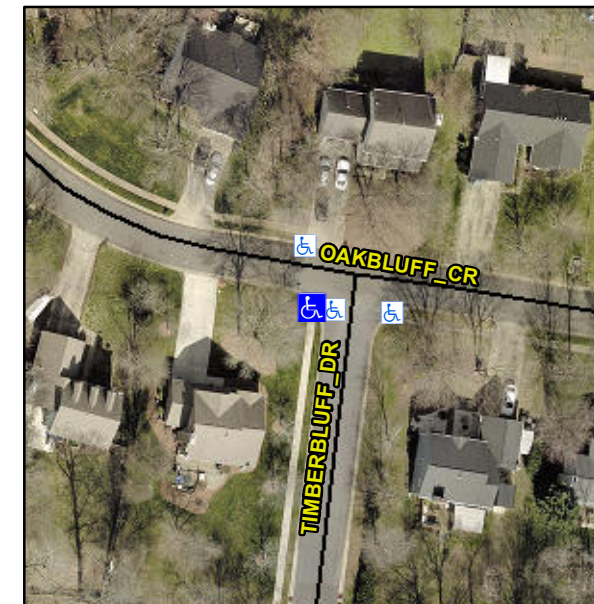

Possible Solutions:

**Remove & Replace Detectable Warning System.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R305.2**

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	44.5	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	1.3	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	1.0			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	59.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	5.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	53.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No		Road Slope (%)	2.0
	X Walk 1 Direction	To N		Road X Slope (%)	0.7
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.7	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.1

