


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 14469 Main Street: E_MOREHEAD_ST Cross Street: KENILWORTH_AV Location: S **Overall Compliance: No ADA ID: 8B411EA356BE** Ramp Type: Perp Initial Pass/Fail: Fail **Severity Score:** 12.5

Codes/Mitigation Info/Possible Solution

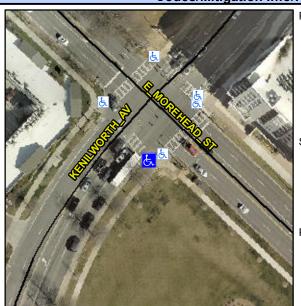

KENILWORTH AV Street 1 Name Stop Condition-Street 2 Signal Street 2 Name N/A Stop Condition-Street 1 N/A

	Possible Solutions:					
STATE OF THE PERSON NAMED IN	Remove & Replace Entire Ramp.					
2000						
1000	Surveyor Notes:					
The second second	N/A					
1	PROW/ADA:					
THE PERSON NAMED IN	R304.5.3					





Total Cost:



1850.00

Field Measurements/Component Compliance								
Compliance Description		Data	Comp	liance	Description	Data		
N/A	Ramp Length (in)	84.0	Yes	Ramp	Slope (%)	5.4		
Yes	Ramp Width (in)	48.0	No	Ramp	XSlope (%)	5.6		
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A		
N/A	Shared Landing?	N/A						
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A		
N/A	Painted X Walk1?	Yes	N/A	Paint	ed X Walk2?	N/A		
	X Walk 1 Direction	To NE		X Wa	lk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	111.0	N/A	X Wa	lk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	3.9		X Wa	lk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	3.3		X Wa	lk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp	inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm	n Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm	n Grate/Utility Type			
		N/A				N/A		
			Yes	Surfa	ce Condition? (G/P)	Good		