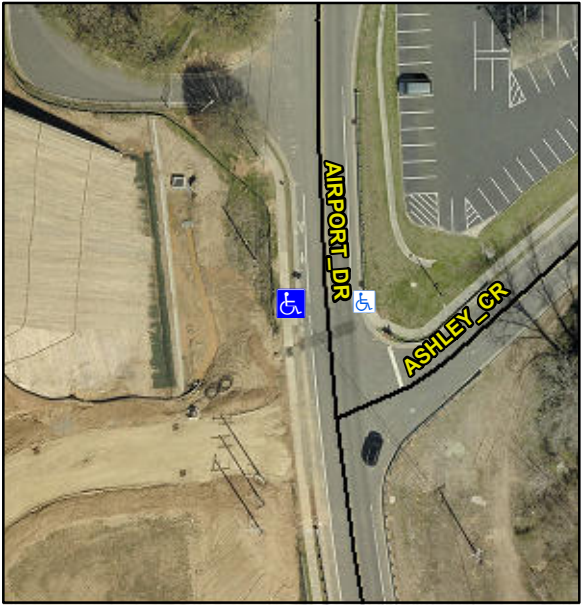


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: AIRPORT_DR	Cross Street: ASHLEY_CRES	Location: NW
ADA ID: 8BEBC99AA446	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	72.0
			Yes	Ramp Width LT (in)	61.0
			Yes	Ramp Slope LT (%)	5.1
			No	Ramp XSlope LT (%)	2.3
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3, R304.3.2</p>			N/A	Ramp Length RT (in)	71.0
			Yes	Ramp Width RT (in)	60.0
			No	Ramp Slope RT (%)	10.1
			No	Ramp XSlope RT (%)	3.6
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	5.7
				X Walk 1 X Slope (%)	1.1
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
				Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
Total Cost:		\$ 1600.00			
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	9.7

