

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7969	Main Street: BROOKSHIRE BV	Cross Street: N_HOSKINS_RD	Location: SW
ADA ID: 8BF63CA0951D	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 25.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

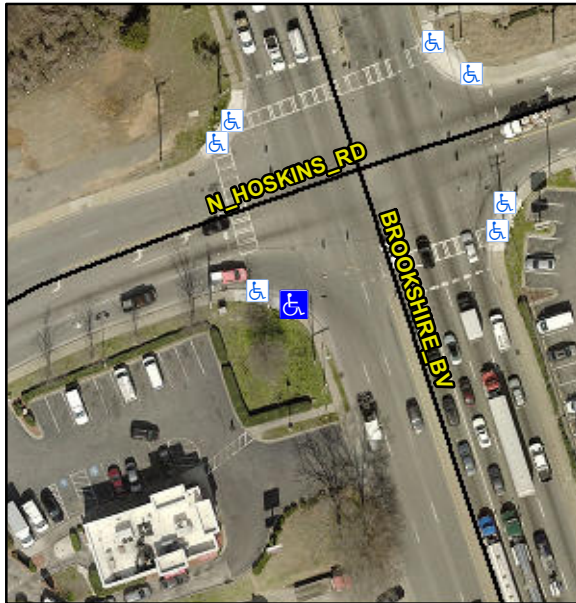

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

LT RP < 5%

PROW/ADA:

**R304.5.3, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R305, R304.5.4**

Street 1 Name	BROOKSHIRE BV
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	64.0	N/A	Ramp Length RT (in)	69.0
Yes	Ramp Width LT (in)	70.5	Yes	Ramp Width RT (in)	70.5
Yes	Ramp Slope LT (%)	3.0	Yes	Ramp Slope RT (%)	7.5
No	Ramp XSlope LT (%)	2.7	No	Ramp XSlope RT (%)	2.6
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	77.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	27.6

