


Intersection ID: 27298	Main Street: CHARTER_HILLS_RD	Cross Street: OWL_NEST_LN	Location:	SW
ADA ID: 8C168B7B94EF	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 22.5

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			N/A	Ramp Length (in)	41.0	No	Ramp Slope (%)	8.9
				No	Ramp Width (in)	46.5	No	Ramp XSlope (%)	2.2
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	N/A			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
				N/A	Shared Landing?	N/A			
	PROW/ADA:			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	R304.5.1, R304.2.2, R304.5.3			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
					X Walk 1 Direction	To E		X Walk 2 Direction	To NE
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	3.5
					X Walk 1 X Slope (%)	4.2		X Walk 2 X Slope (%)	1.9
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Street 1 Name	OWL NEST LN				Road Slope (%)	3.7	N/A	Clear Space?	N/A
	Stop Condition-Street 2				Road X Slope (%)	5.8	N/A	Clear Space to XWalk (in)	N/A
	Street 2 Name				Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Stop Condition-Street 1				Obstruction Type			Storm Grate/Utility Type	
						N/A			N/A
							Yes	Surface Condition? (G/P)	Good
Total Cost:			\$	3200.00					

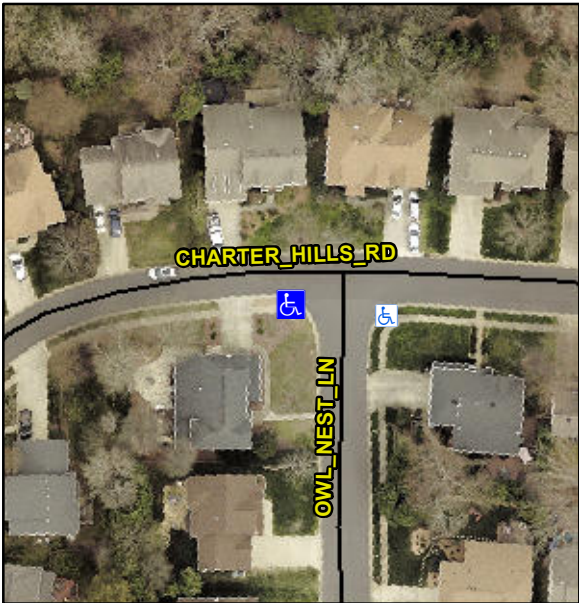