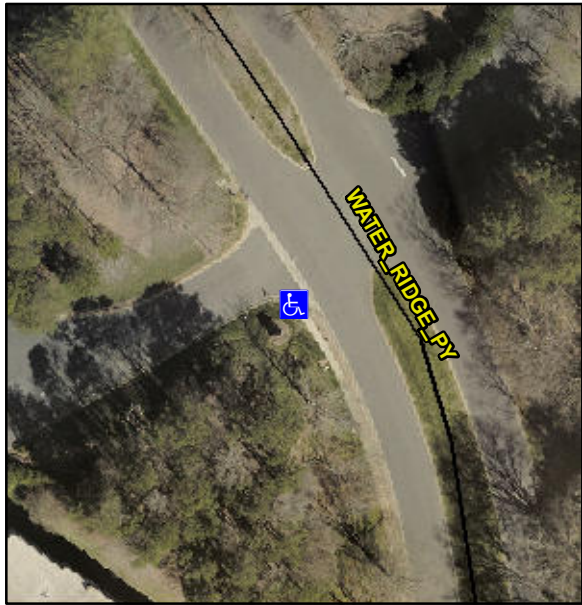


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 10041074	Main Street: WATER RIDGE PY	Cross Street: N/A	Location: SW
ADA ID: 8C6A96D1439D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 46.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	39.0	No	Ramp Slope (%)	10.4
		No	Ramp Width (in)	38.0	No	Ramp XSlope (%)	8.4
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To E		X Walk 2 Direction	To N
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	8.4
			X Walk 1 X Slope (%)	4.0		X Walk 2 X Slope (%)	4.8
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
PROW/ADA:	Not Found, R304.5.1, R304.2.2, R304.5.3		Road Slope (%)	6.2	N/A	Clear Space?	N/A
			Road X Slope (%)	2.1	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
	Total Cost:		\$	3200.00			
	Street 1 Name		WATER RIDGE PY				
	Stop Condition-Street 2		None				
	Street 2 Name		ENTRANCE				
Stop Condition-Street 1		StopSign					

Total Cost: \$ 3200.00

