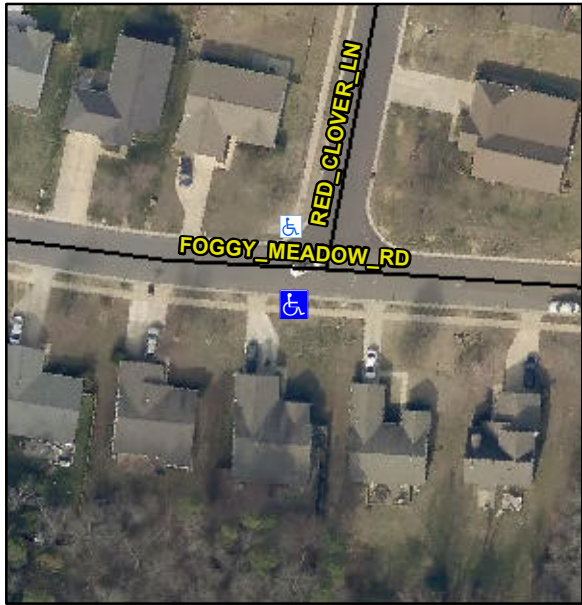


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 2903	Main Street: FOGGY_MEADOW_RD	Cross Street: RED_CLOVER_LN	Location:	SW
ADA ID: 8CC4CC5A6404	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 7.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Gutter.		N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	7.2
			Yes	Ramp Width (in)	60.0	Yes	Ramp XSlope (%)	1.3
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	0.7	N/A	Flare Slope RT (%)	7.2
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	0.2	Yes	DWS Length (in)	24.0
			Yes	Landing X Slope (%)	1.5	Yes	DWS Full Width?	Yes
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
PROW/ADA:		R302.7.2, R304.5.3	N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.6
			No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.4
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To N		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	6.7		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	Clear Space?	Yes
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good

Street 1 Name	FOGGY MEADOW RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost:	\$	750.00
-------------	----	--------

