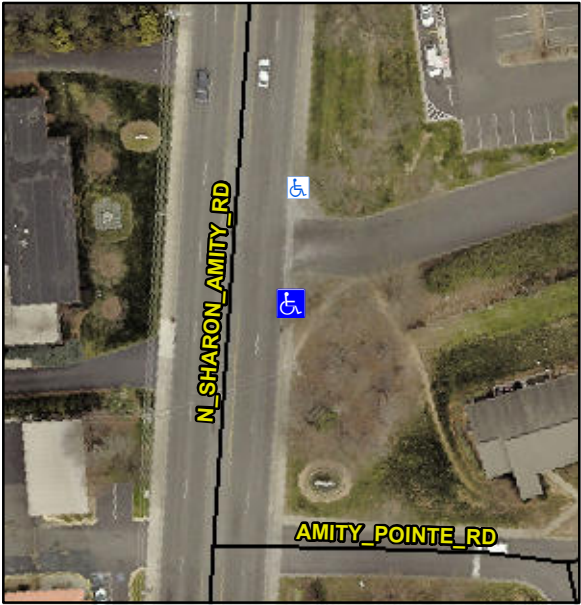


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10011741	Main Street: N_SHARON_AMITY_RD	Cross Street: N/A	Location: SE
ADA ID: 8CD09AC9781E	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>
	Surveyor Notes:		<b>N/A</b>
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>	ENTRANCE		<b>None</b>
	N SHARON AMITY RD		<b>None</b>
PROW/ADA:		<b>Not Found, R304.5.1, R304.2.2, R304.5.3, R302.7</b>	
Total Cost:		\$ 3200.00	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.0	No	Ramp Slope (%)	15.4
No	Ramp Width (in)	45.0	No	Ramp XSlope (%)	3.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	1.9
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	0.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.7	N/A	Clear Space?	N/A
	Road X Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		No		Surface Condition? (G/P)	Poor

