


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3474	Main Street: W_W_T_HARRIS_BV	Cross Street: W_WT_HARRIS_TO_I-77_RA_NB	Location: SW
ADA ID: 8D23495F03EE	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

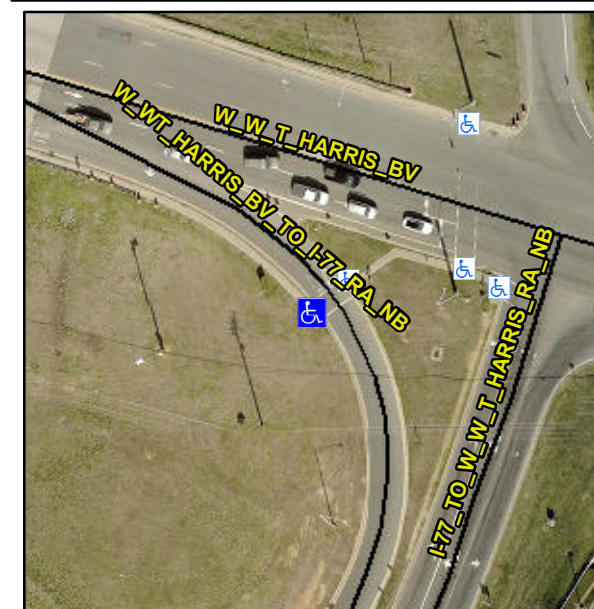

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

NO LT SW

PROW/ADA:

R304.5.3, R305.1.4, R305.2

Street 1 Name	W W T HARRIS BV TO I-77 RAMP
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	72.0	N/A	Ramp Length RT (in)	75.5
Yes	Ramp Width LT (in)	62.0	Yes	Ramp Width RT (in)	60.0
Yes	Ramp Slope LT (%)	5.6	Yes	Ramp Slope RT (%)	8.2
No	Ramp XSlope LT (%)	2.5	Yes	Ramp XSlope RT (%)	1.8
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	56.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.1	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	122.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.4

