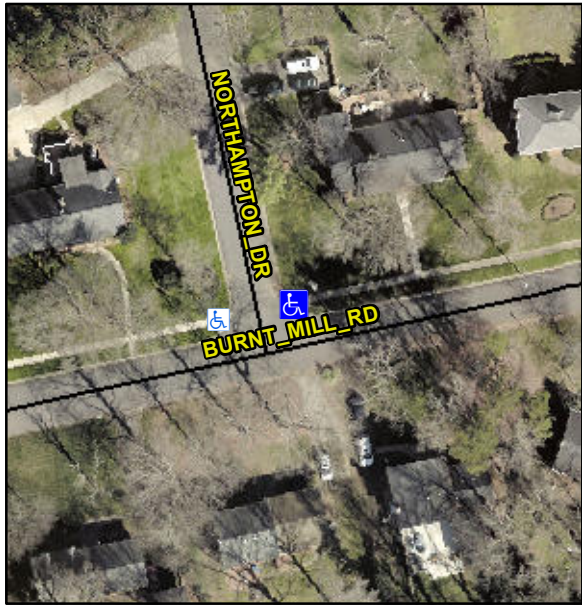


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 21311	Main Street: BURNT_MILL_RD	Cross Street: NORTHAMPTON_DR	Location: NE
ADA ID: 8D8466D7E334	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 37.5			

	Possible Solutions:							
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.							
	Surveyor Notes:							
	N/A							
	PROW/ADA:							
	Not Found, R304.2.2, R304.5.3							
	Street 1 Name	NORTHHAMPTON DR	Compliance	Description	Data	Compliance	Description	Data
	Stop Condition-Street 2	StopSign	N/A	Ramp Length (in)	52.0	No	Ramp Slope (%)	9.9
	Street 2 Name	BURNT MILL RD	Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	8.8
	Stop Condition-Street 1	None	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To W		X Walk 2 Direction	To S	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	5.9		X Walk 2 Slope (%)	8.3	
			X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	8.1	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	7.1	N/A	Clear Space?	N/A	
			Road X Slope (%)	5.1	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	3200.00					

