


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 10862	Main Street: N_GRAHAM_ST	Cross Street: DALTON_AV	Location: NW
ADA ID: 8DA28E0884E7	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
<b>Codes/Mitigation Info/Possible Solution</b>			<b>Field Measurements/Component Compliance</b>

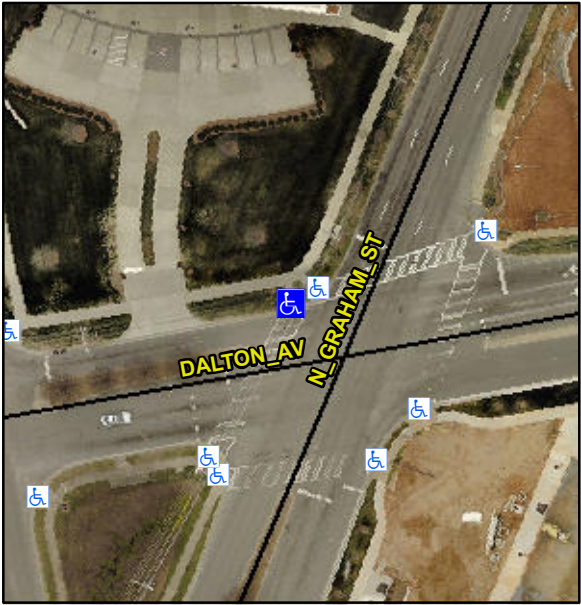

Possible Solutions:  
**Remove & Replace Entire Ramp.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**Not Found, R304.5.1**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	143.0	Yes	Ramp Slope (%)	6.0
No	Ramp Width (in)	47.5	Yes	Ramp XSlope (%)	3.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	140.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1850.00

Street 1 Name	DALTON AV
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

