

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data


Intersection ID: 10040584Main Street: W_ARROWOOD_RDCross Street: N/ALocation:NEADA ID: 8DC85121BD4FRamp Type: PerpendicularInitial Pass/Fail: PassOverall Compliance: NoSeverity Score: 2.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Compliance Description

Data

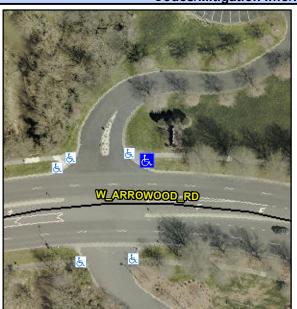

Street 1 Name WARROWOOD RD
Stop Condition-Street 2 None
Street 2 Name N/A
Stop Condition-Street 1 N/A

Possible Solutions:	Compli	ance	Description
Remove & Replace Entire Ramp.	N/A	Ramp	Length (in)
	Yes	Ramp	Width (in)
	N/A	Flare	Type LT
	N/A	Flare	Slope LT (%)
	N/A	Flare	Traversable LT
	Yes	Land	ing Length (in)
Surveyor Notes:	Yes	Land	ing Width (in)
N/A	Yes	Land	ing Slope (%)
	No	Land	ing X Slope (%
	N/A	Land	ing Curb? (Y/N
	N/A	Share	ed Landing?
PROW/ADA:	Yes	Gutte	er Ponding?
R304.5.3, R305.1.4, R305.2	Yes	Gutte	er Lip Ht (in)
	N/A	Paint	ed X Walk1?
		X Wa	lk 1 Direction
	N/A	X Wa	lk 1 Width (in)
		X Wa	lk 1 Slope (%)
		X Wa	lk 1 X Slope (%
	N/A	Ramp	o inside XWalk

Total Cost:		\$ 1850.00
	mile of the second	







