

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10016404	Main Street: MILHAVEN_LN	Cross Street: N/A	Location: W
ADA ID: 8E25581E9911	Ramp Type: Directional	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

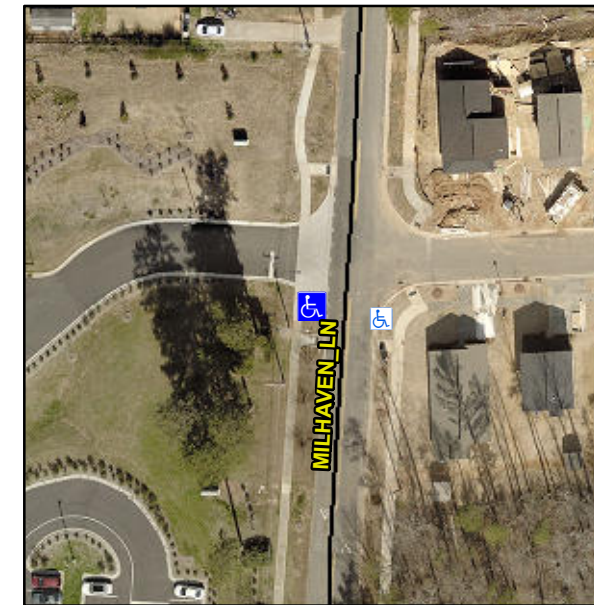

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

NO CURB

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R305.1.4, R305.2, R302.7,
R302.7.2, R304.5.4**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	87.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	62.5	Yes	Grade Break Slope (%)	3.4
Yes	Ramp Slope (%)	7.1	Yes	Grade Break XSlope (%)	0.1
Yes	Ramp XSlope (%)	0.5			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	58.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	62.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.4	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	36.5
N/A	Shared Landing?	No	No	DWS Offset RT (in)	5.0
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	5.5
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	0.3
N/A	Painted X Walk1?	No		Road Slope (%)	5.7
	X Walk 1 Direction	To E		Road X Slope (%)	0.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	5.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	9.2

