

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52599	Main Street: W_TYVOLA_RD	Cross Street: POTOMAC_RIVER_PY	Location: NW
ADA ID: 8E929AD83A82	Ramp Type: Perpendicular Diagonal	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 2.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

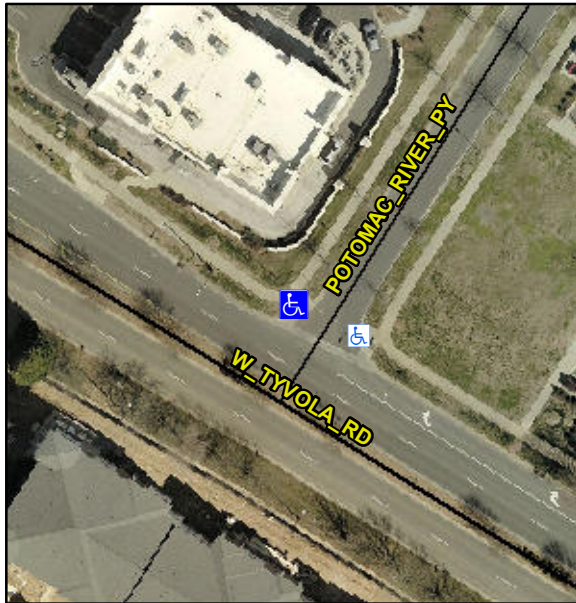

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305.1.4, R305.2

Street 1 Name **W TYVOLA RD**
 Stop Condition-Street 2 **None**
 Street 2 Name **POTOMAC RIVER PY**
 Stop Condition-Street 1 **StopSign**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	92.0	Yes	Ramp Slope (%)	7.6
Yes	Ramp Width (in)	50.0	No	Ramp XSlope (%)	2.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.2	N/A	Flare Slope RT (%)	7.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	50.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.9	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	2.1	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.9		X Walk 2 Slope (%)	1.8
	X Walk 1 X Slope (%)	3.6		X Walk 2 X Slope (%)	2.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5	N/A	Clear Space?	Yes
	Road X Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

