


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13432	Main Street: E_8TH_ST	Cross Street: LOUISE_AV	Location: SE
ADA ID: 8E9F51072676	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 30			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

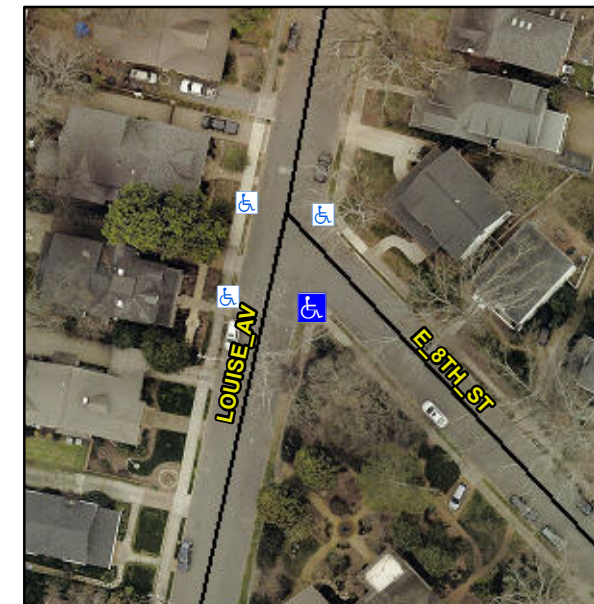

Possible Solutions:

**Install Detectable Warning System.
Remove & Replace Gutter.**

Surveyor Notes:

GTR GAP 2.0

PROW/ADA:

R305, R302.7, R302.7.2, R304.5.4

Total Cost: \$ 985.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	76.0	Yes	BlendTrans Slope (%)	1.9
Yes	Ramp Width (in)	192.0	Yes	BlendTrans XSlope (%)	1.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	9.9	N/A	Flare Slope RT (%)	8.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	No	DWS Provided?	No
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	8.4
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.9		X Walk 2 Slope (%)	1.9
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	4.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5		Clear Space?	Yes
	Road X Slope (%)	5.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	4.9

