


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|-----------------------------------------|-----------------------------------|-----------------------------------------|------------------------|
| Intersection ID: N/A | Main Street: PERIWINKLE_HILL_CT | Cross Street: N/A | Location: N |
| ADA ID: 8EF2002B421B | Ramp Type: Perpendicular Diagonal | Initial Pass/Fail: Pass | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |

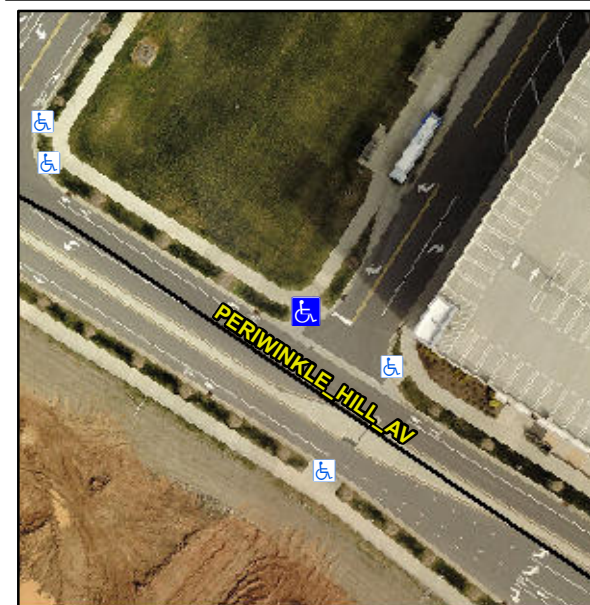

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3

Street 1 Name **PERIWINKLE HILL CT**
 Stop Condition-Street 2 **None**
 Street 2 Name **ENTRANCE**
 Stop Condition-Street 1 **StopSign**

Total Cost: \$ **3200.00**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|--------|------------|-----------------------------|-------|
| N/A | Ramp Length (in) | 95.0 | Yes | Ramp Slope (%) | 7.9 |
| Yes | Ramp Width (in) | 48.0 | No | Ramp XSlope (%) | 4.2 |
| N/A | Flare Type LT | Sloped | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | 2.9 | N/A | Flare Slope RT (%) | 9.4 |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 60.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 60.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 0.2 | Yes | DWS Length (in) | 24.0 |
| No | Landing X Slope (%) | 4.1 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 2.0 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 2.4 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 2.0 |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | To SE |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 4.5 | | X Walk 2 Slope (%) | 6.6 |
| | X Walk 1 X Slope (%) | 6.7 | | X Walk 2 X Slope (%) | 1.8 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 2.2 | N/A | Clear Space? | Yes |
| | Road X Slope (%) | 6.5 | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

