

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 44266	Main Street: ISAAC_HUNTER_DR	Cross Street: ASHLYN_ELIZABETH_CT	Location: NE
ADA ID: 8F2450C1E545	Ramp Type: Perpendicular Diagonal	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 57.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

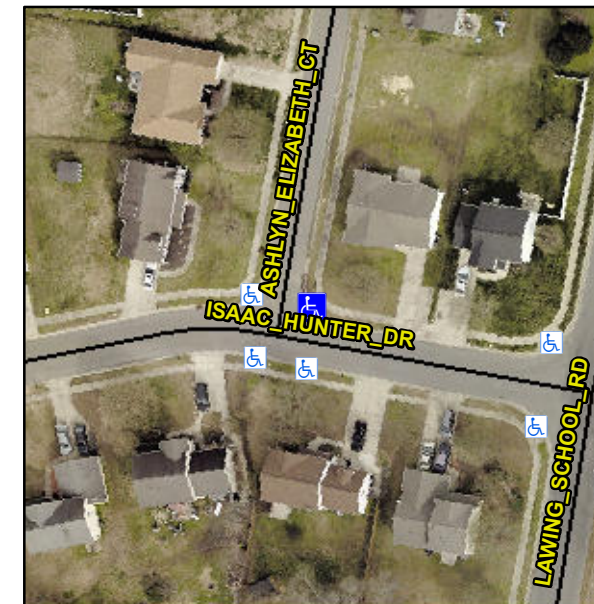

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2, R304.5.3, R302.7

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.5	No	Ramp Slope (%)	11.3
No	Ramp Width (in)	33.0	No	Ramp XSlope (%)	5.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	4.8
	X Walk 1 X Slope (%)	4.3		X Walk 2 X Slope (%)	5.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.2	N/A	Clear Space?	N/A
	Road X Slope (%)	0.3	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		No		Surface Condition? (G/P)	Poor

Street 1 Name ASHLYN ELIZABETH CT
 Stop Condition-Street 2 StopSign
 Street 2 Name ISAAC HUNTER DR
 Stop Condition-Street 1 None

