

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11958	Main Street: E_16TH_ST	Cross Street: SEIGLE_AV	Location: W
ADA ID: 8F3F7E890F1D	Ramp Type: Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

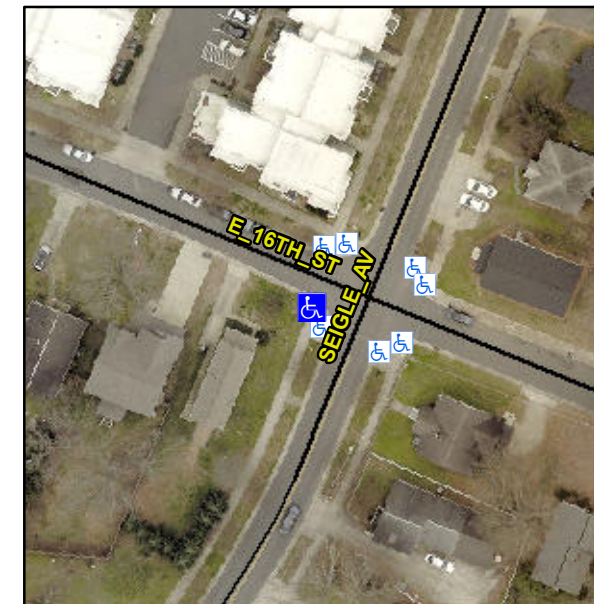

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4, R305.2, R304.5.3

Total Cost: \$ 1550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	55.0	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.3
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	58.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	12.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.1
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	6.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name E 16TH ST
 Stop Condition-Street 2 StopSign
 Street 2 Name N/A
 Stop Condition-Street 1 N/A

