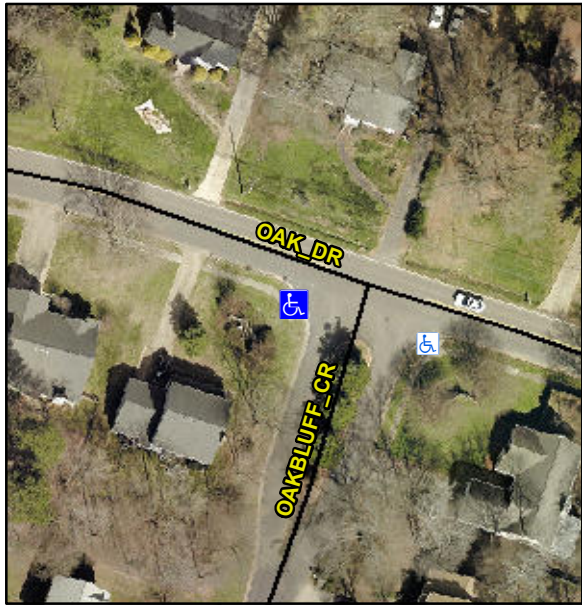


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5987	Main Street: OAK_DR	Cross Street: OAKBLUFF_CR	Location: W
ADA ID: 8F45E56EEBBA	Ramp Type: Perpendicular	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	100.0	Yes	Ramp Slope (%)	5.3
			Yes	Ramp Width (in)	48.5	No	Ramp XSlope (%)	6.5
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R304.5.3	N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	6.2		X Walk 2 X Slope (%)	N/A
Street 1 Name		OAKBLUFF CR	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Stop Condition-Street 2		StopSign		Road Slope (%)	N/A	N/A	Clear Space?	N/A
Street 2 Name		N/A		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Stop Condition-Street 1		N/A	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 1850.00						

Street 1 Name	OAKBLUFF CR
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

