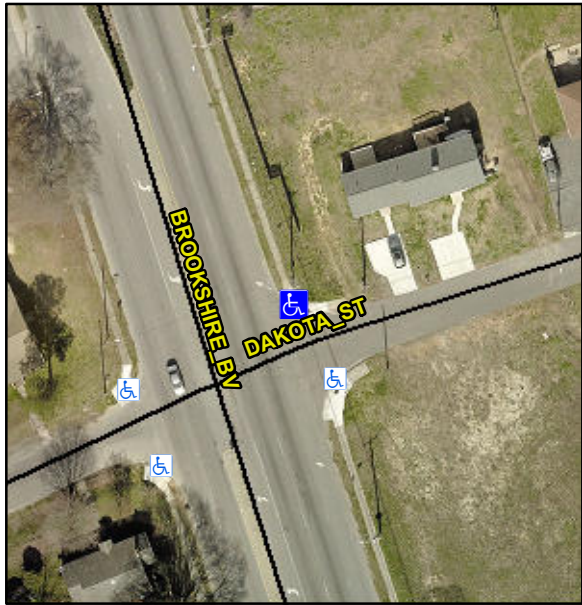


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7826	Main Street: BROOKSHIRE_BV	Cross Street: DAKOTA_ST	Location: NW
ADA ID: 8F7D98FAD6EC	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	53.0	N/A	Ramp Length RT (in)	65.0
			Yes	Ramp Width LT (in)	54.0	Yes	Ramp Width RT (in)	54.0
			No	Ramp Slope LT (%)	10.9	Yes	Ramp Slope RT (%)	0.7
			No	Ramp XSlope LT (%)	2.4	Yes	Ramp XSlope RT (%)	1.5
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Surveyor Notes:		N/A	Shared Landing?	N/A				
RT RP < 5%		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	N/A
PROW/ADA:		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	N/A
R304.3.2, R304.5.3		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	N/A
			X Walk 1 Direction	To SE		X Walk 2 Direction	N/A	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	4.9		X Walk 2 Slope (%)	N/A	N/A
			X Walk 1 X Slope (%)	6.3		X Walk 2 X Slope (%)	N/A	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	N/A	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	N/A
			Obstruction Type			Storm Grate/Utility Type		
Total Cost:		\$ 1600.00			N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	25.1

