


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10023519	Main Street: CLANTON_RD	Cross Street: N/A	Location: E
ADA ID: 8FBC0B5BD7D6	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: Yes
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

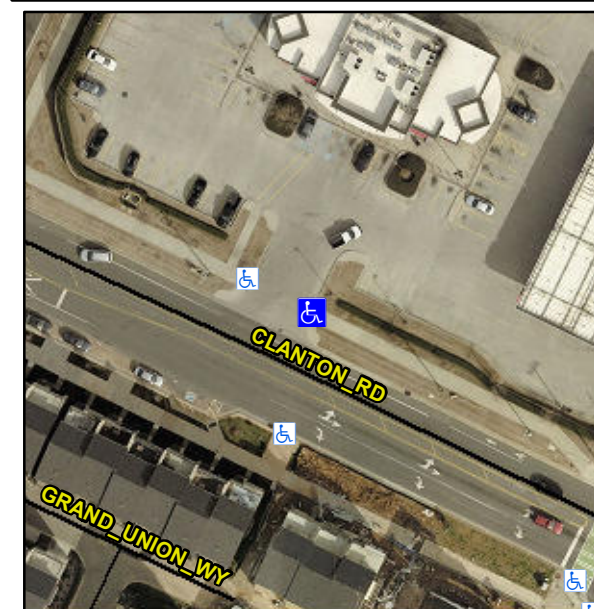

Possible Solutions:

N/A

Surveyor Notes:

NO CURB LINE

PROW/ADA:

N/A

Total Cost:

\$ 0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	134.0	Yes	BlendTrans Slope (%)	3.1
Yes	Ramp Width (in)	96.0	Yes	BlendTrans XSlope (%)	0.1
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	103.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	96.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.2		Clear Space?	Yes
	Road X Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name	ENTRANCE
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

