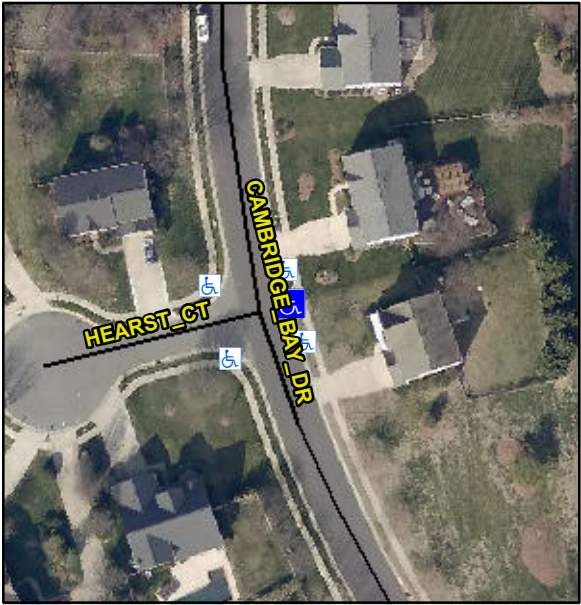


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2480	Main Street: CAMBRIDGE_BAY_DR	Cross Street: HEARST_CT	Location: E
ADA ID: 9016ED46E1E9	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 12.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	44.5
	Remove & Replace Gutter.		Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	Sloped
			N/A	Flare Slope LT (%)	10.3
			N/A	Flare Traversable LT?	Yes
			Yes	Landing Length (in)	50.0
			Yes	Landing Width (in)	48.0
			No	Landing Slope (%)	2.3
			No	Landing X Slope (%)	3.5
Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.2.3, R305			N/A	Flare Type RT	N/A
			Yes	Flare Slope RT (%)	0.4
			N/A	Flare Traversable RT?	Yes
			No	DWS Provided?	No
			N/A	DWS Contrast?	No
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	No
			N/A	DWS Offset (in)	N/A
			Yes	Gutter Ponding?	No
			Yes	Gutter Lip Ht (in)	0.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To W
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	3.3
				X Walk 1 X Slope (%)	2.5
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			Yes	Any Obstructions?	No
				Obstruction Type	
Total Cost: \$ 2600.00			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

