


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 29600	Main Street: FOREST_POINT_BV	Cross Street: FOREST_PINE_DR	Location: SW
ADA ID: 901B66613913	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 22.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

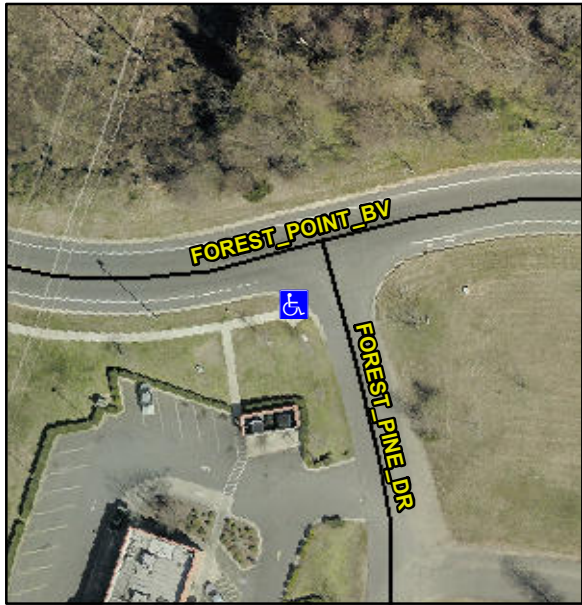

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2, R304.5.3

Street 1 NameFOREST PINE DR

Stop Condition-Street 2None

Street 2 NameFOREST POINT BV

Stop Condition-Street 1None

Total Cost:\$3200.00

Compliance		Description	Data	Compliance		Description	Data
N/A		Ramp Length (in)	55.0	No		Ramp Slope (%)	9.1
No		Ramp Width (in)	46.5	No		Ramp XSlope (%)	3.5
N/A		Flare Type LT	N/A	N/A		Flare Type RT	N/A
N/A		Flare Slope LT (%)	N/A	N/A		Flare Slope RT (%)	N/A
N/A		Flare Traversable LT?	N/A	N/A		Flare Traversable RT?	N/A
N/A		Landing Length (in)	N/A	N/A		DWS Provided?	N/A
N/A		Landing Width (in)	N/A	N/A		DWS Contrast?	N/A
N/A		Landing Slope (%)	N/A	N/A		DWS Length (in)	N/A
N/A		Landing X Slope (%)	N/A	N/A		DWS Full Width?	N/A
N/A		Landing Curb? (Y/N)	N/A	N/A		DWS Offset (in)	N/A
N/A		Shared Landing?	N/A				
N/A		Gutter Ponding?	N/A	N/A		Gutter Slope (%)	N/A
N/A		Gutter Lip Ht (in)	N/A	N/A		Gutter X Slope (%)	N/A
N/A		Painted X Walk1?	No	N/A		Painted X Walk2?	No
		X Walk 1 Direction	To E			X Walk 2 Direction	To N
N/A		X Walk 1 Width (in)	N/A	N/A		X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	3.4			X Walk 2 Slope (%)	2.0
		X Walk 1 X Slope (%)	2.9			X Walk 2 X Slope (%)	3.4
N/A		Ramp inside XWalk1?	N/A	N/A		Ramp inside XWalk2?	N/A
		Road Slope (%)	0.9	N/A		Clear Space?	N/A
		Road X Slope (%)	4.3	N/A		Clear Space to XWalk (in)	N/A
N/A		Any Obstructions?	N/A	N/A		Storm Grate/Utility Hazard?	N/A
		Obstruction Type				Storm Grate/Utility Type	
			N/A				N/A
				Yes		Surface Condition? (G/P)	Good

