


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 8368	Main Street: HONDURES_DR	Cross Street: W_SUGAR_CREEK_RD	Location: SW
ADA ID: 9106B9854A64	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 48.75			

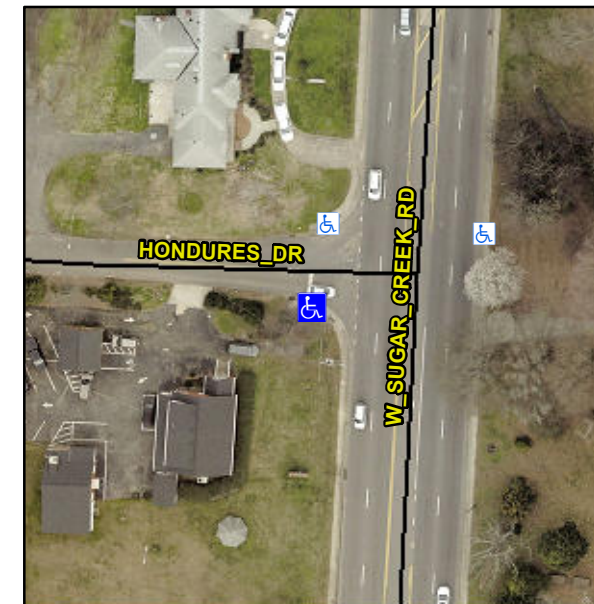

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**LT RP < 5%**

PROW/ADA:

**R304.5.1, R304.5.3, R304.3.2**

Street 1 Name **W SUGAR CREEK RD**  
 Stop Condition-Street 1 **None**  
 Street 2 Name **HONDURES DR**  
 Stop Condition-Street 2 **YieldSign**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	56.0	N/A	Ramp Length RT (in)	59.0
No	Ramp Width LT (in)	26.0	No	Ramp Width RT (in)	32.0
Yes	Ramp Slope LT (%)	1.6	No	Ramp Slope RT (%)	11.7
No	Ramp XSlope LT (%)	2.8	Yes	Ramp XSlope RT (%)	1.6
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	2.3
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	2.5
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.8	N/A	Clear Space?	N/A
	Road X Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	23.6

