


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28378	Main Street: BALDWIN_HALL_DR	Cross Street: SOUTHAMPTON_COMMONS_DR	Location: SE
ADA ID: 917792760F68	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 15.25			

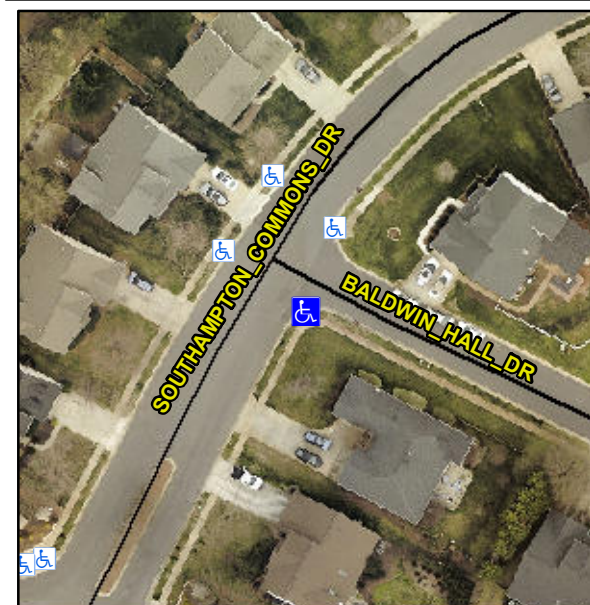

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R304.5.4

Street 1 Name **BALDWIN HALL DR**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **SOUTHAMPTON COMMONS DR**
 Stop Condition-Street 1 **None**

Total Cost: \$ **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.2
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.2	N/A	Flare Slope RT (%)	9.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	47.0	No	DWS Provided?	No
Yes	Landing Width (in)	67.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.7	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	4.6	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	10.5
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	5.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	5.3
	X Walk 1 X Slope (%)	3.8		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.0	N/A	Clear Space?	Yes
	Road X Slope (%)	2.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

