

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 14071	Main Street: CLEVELAND_AV	Cross Street: E_KINGSTON_AV	Location: E
ADA ID: 918C5B5CDA6D	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

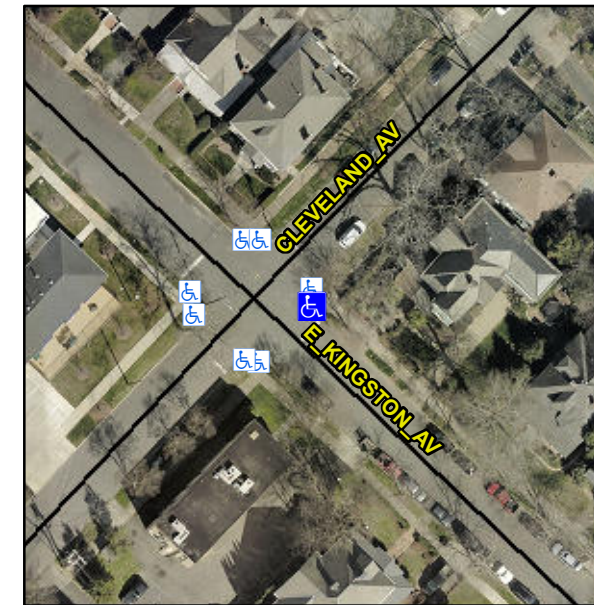

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**NO CURB LINE, ASP LIP 1.0"**

PROW/ADA:

**R304.2.2, R304.5.3**

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	84.0	N/A	Grade Break Slope (%)	0.0
No	Ramp Slope (%)	9.9	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	2.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	5.1
	X Walk 1 Direction	To SW		Road X Slope (%)	2.7
	X Walk 1 Width (in)	N/A		Clear Space?	N/A
	X Walk 1 Slope (%)	5.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.7	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	13.7

Street 1 Name	E KINGSTON AV
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

