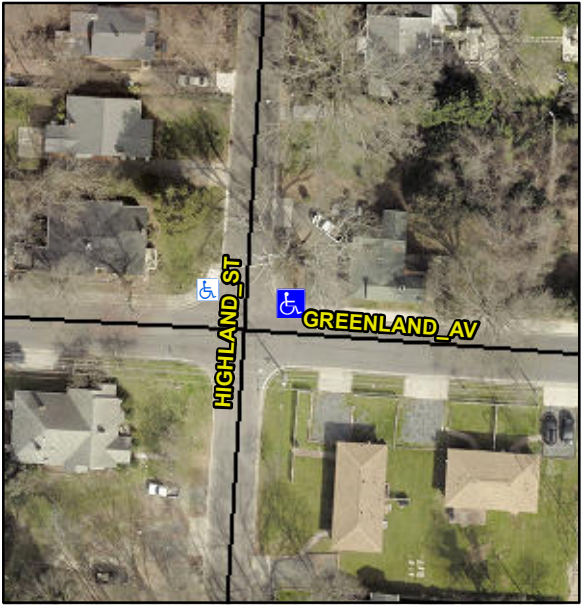


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12322	Main Street: HIGHLAND_ST	Cross Street: GREENLAND_AV	Location: NE
ADA ID: 91B7184F38E2	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	36.0
			Yes	Ramp Width LT (in)	59.5
			No	Ramp Slope LT (%)	9.5
			No	Ramp XSlope LT (%)	2.6
			N/A	Ramp Length (in)	24.5
			Yes	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
<p>Surveyor Notes:</p> <p>RT RP < 5%</p> <p>PROW/ADA:</p> <p>Not Found, R304.3.2, R304.5.3</p>			N/A	Ramp Slope RT (%)	4.1
			Yes	Ramp XSlope RT (%)	1.3
			Yes	Ramp Slope (%)	7.4
			Yes	Ramp XSlope (%)	1.2
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p>			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	N/A
			No	Painted X Walk2?	N/A
			To W	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			1.5	X Walk 2 Slope (%)	N/A
			0.5	X Walk 2 X Slope (%)	N/A
<p>Total Cost:</p> <p>\$ 1800.00</p>			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	8.1

