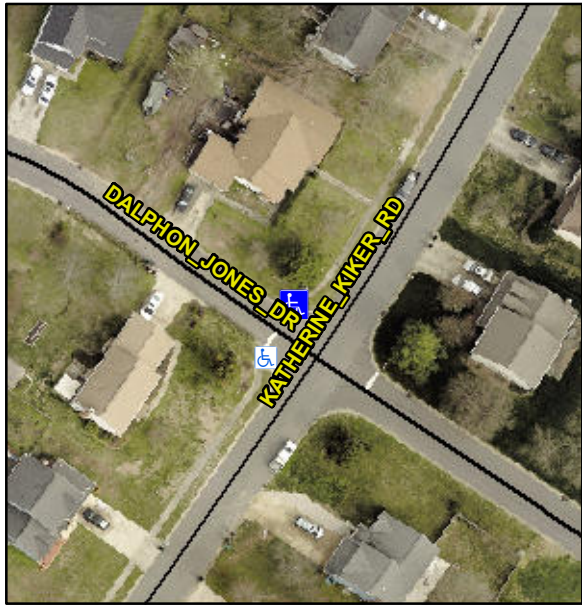


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 6347	Main Street: DALPHON_JONES_DR	Cross Street: KATHERINE_KIKER_RD	Location:	N
ADA ID: 91BEE0610726	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 30

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	49.5	Yes	Ramp Slope (%)	5.9
	Remove & Replace Gutter.		Yes	Ramp Width (in)	69.0	Yes	Ramp XSlope (%)	0.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	4.1	N/A	Flare Slope RT (%)	4.3
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			No	Landing Length (in)	43.0	No	DWS Provided?	No
			Yes	Landing Width (in)	69.0	N/A	DWS Contrast?	No
			Yes	Landing Slope (%)	0.5	N/A	DWS Length (in)	N/A
			Yes	Landing X Slope (%)	1.2	N/A	DWS Full Width?	No
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R304.2.1, R305, R302.7, R302.7.2, R304.5.4	N/A	Shared Landing?	No	No	Gutter Slope (%)	6.4
			No	Gutter Ponding?	Yes	Yes	Gutter X Slope (%)	1.3
			No	Gutter Lip Ht (in)	1.0	N/A	Painted X Walk2?	N/A
			N/A	Painted X Walk1?	No		X Walk 2 Direction	N/A
				X Walk 1 Direction	To W		X Walk 2 Width (in)	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Slope (%)	N/A
				X Walk 1 Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
				X Walk 1 X Slope (%)	0.4		Ramp inside XWalk2?	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Clear Space?	Yes
				Road Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
				Road X Slope (%)	N/A	N/A	Storm Grate/Utility Hazard?	No
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Type	
				Obstruction Type				
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 2600.00						

