


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 48568	Main Street: BRAMBLE RIDGE CT	Cross Street: SALAMANDER RUN LN	Location: SW
ADA ID: 9246B6DBAA83	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

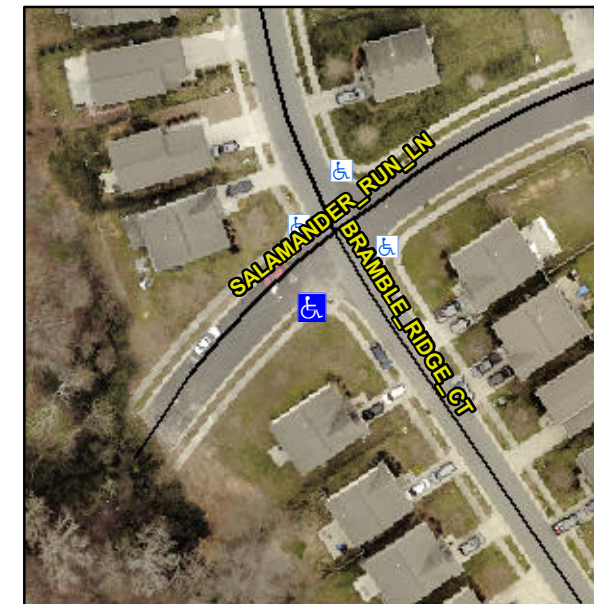

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R302.7**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.5	Yes	Ramp Slope (%)	7.7
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	0.9	N/A	Flare Slope RT (%)	0.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	46.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	80.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	4.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	1.1
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	0.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.4	N/A	Clear Space?	Yes
	Road X Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

