


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: N/A	Main Street: KIMMERLY_GLEN_LN	Cross Street: KIMMERLY_CREEK_DR	Location: NW
ADA ID: 92903CF07AC1	Ramp Type: Directional	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 10.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

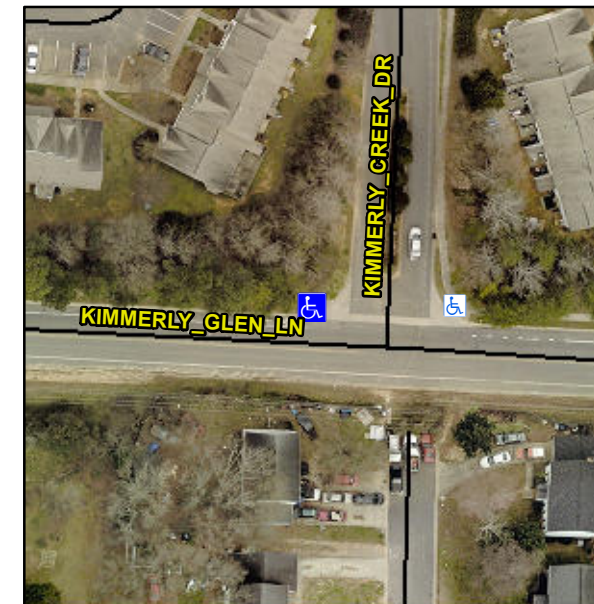

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	89.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	50.0	Yes	Grade Break Slope (%)	0.3
Yes	Ramp Slope (%)	1.7	No	Grade Break XSlope (%)	4.0
No	Ramp XSlope (%)	2.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.9	N/A	Flare Slope RT (%)	1.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	51.5	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.1	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.9	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	No	N/A	DWS Offset RT (in)	N/A
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	No		Road Slope (%)	1.7
	X Walk 1 Direction	To E		Road X Slope (%)	0.0
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.0	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.7

