

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 8925	Main Street: E_W_T_HARRIS_BV	Cross Street: THE_PLAZA	Location: SE
ADA ID: 92FCDFDC2C5C	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.75	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

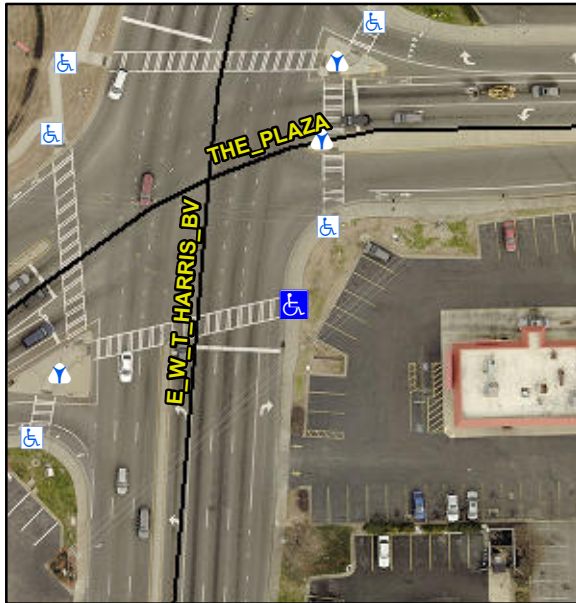

Possible Solutions:

**Remove & Replace Entire Ramp.  
Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.2-Perp, R304.3.2-  
Para, R305.2, R302.7, R302.7.2**

Street 1 Name	<b>E W T HARRIS BV</b>
Stop Condition-Street 1	<b>Signal</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 2	<b>N/A</b>

Total Cost: \$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	74.0	N/A	Ramp Length RT (in)	70.0
Yes	Ramp Width LT (in)	82.5	Yes	Ramp Width RT (in)	82.5
Yes	Ramp Slope LT (%)	6.8	Yes	Ramp Slope RT (%)	6.8
No	Ramp XSlope LT (%)	2.1	No	Ramp XSlope RT (%)	2.5
Yes	Landing Length (in)	82.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	2.1
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	114.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.5

