

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13809	Main Street: CHESTERFIELD_AV	Cross Street: ST_JULIEN_ST	Location: W
ADA ID: 9362C8B1D37E	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

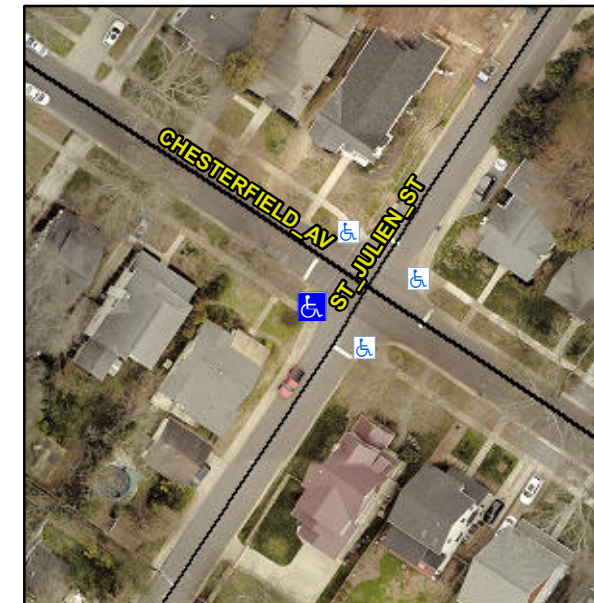

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R305.1.4, R305.2, R302.7

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	61.0	Yes	BlendTrans Slope (%)	2.3
Yes	Ramp Width (in)	65.0	Yes	BlendTrans XSlope (%)	1.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.5	N/A	Flare Slope RT (%)	2.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	88.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	42.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.9		X Walk 2 Slope (%)	6.0
	X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	1.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.9		Clear Space?	Yes
	Road X Slope (%)	3.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	8.5

Street 1 Name ST JULIEN ST
 Stop Condition-Street 1 StopSign
 Street 2 Name CHESTERFIELD AV
 Stop Condition-Street 2 StopSign

