


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49560	Main Street: SPENCER_ST	Cross Street: WARREN_BURGESS_LN	Location: NE
ADA ID: 9429980F3671	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 17.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

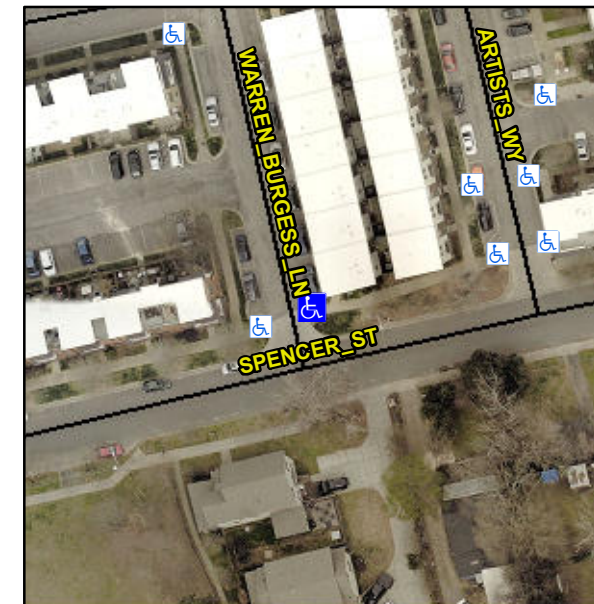

Possible Solutions:

**Install Detectable Warning System.
Remove & Replace Gutter.**

Surveyor Notes:

COLLECTED WITH ULIP

PROW/ADA:

R305, R302.7.2, R304.5.3

Total Cost: \$ 985.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	67.0	Yes	BlendTrans Slope (%)	0.9
Yes	Ramp Width (in)	72.0	Yes	BlendTrans XSlope (%)	2.0
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	No	DWS Provided?	No
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.5
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	60.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.3		Clear Space?	Yes
	Road X Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	0.1

Street 1 Name **WARREN BURGESS LN**

Stop Condition-Street 1 **StopSign**

Street 2 Name **N/A**

Stop Condition-Street 2 **N/A**

