


| | | | | |
|-----------------------|------------------------|---------------------------|------------------------|--------------------|
| Intersection ID: 9779 | Main Street: CAMPUS_ST | Cross Street: CEMETERY_ST | Location: | SW |
| ADA ID: 948FD2B791C5 | Ramp Type: PerpDiag | Initial Pass/Fail: Fail | Overall Compliance: No | Severity Score: 35 |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|---|---|
|---|---|

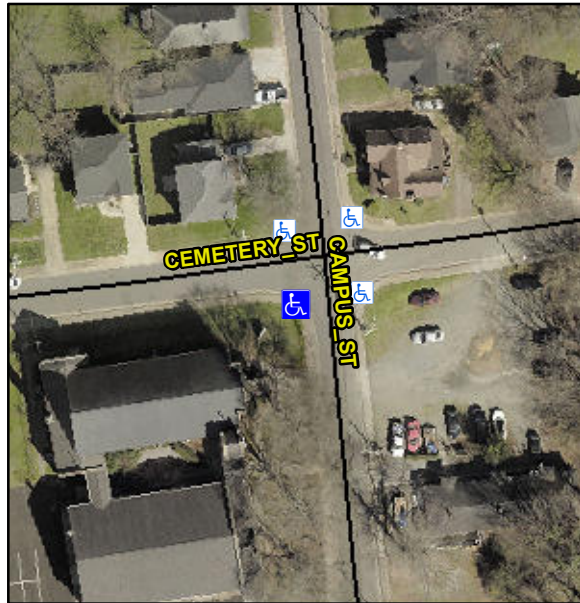

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.1, R304.2.2,
R304.5.3**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 47.0 | No | Ramp Slope (%) | 12.4 |
| No | Ramp Width (in) | 40.0 | No | Ramp XSlope (%) | 2.2 |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | 0.8 | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To E | | X Walk 2 Direction | To N |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 0.9 | | X Walk 2 Slope (%) | 2.4 |
| | X Walk 1 X Slope (%) | 1.7 | | X Walk 2 X Slope (%) | 2.1 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 2.6 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 1.3 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

Total Cost: \$ 3200.00

| | |
|-------------------------|-----------------|
| Street 1 Name | CAMPUS STREET |
| Stop Condition-Street 2 | None |
| Street 2 Name | CEMETERY STREET |
| Stop Condition-Street 1 | StopSign |

