


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5855	Main Street: W_SUGAR_CREEK_RD	Cross Street: NEVIN_RD	Location:	E
ADA ID: 95D6DC9AB5E1	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5.25
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

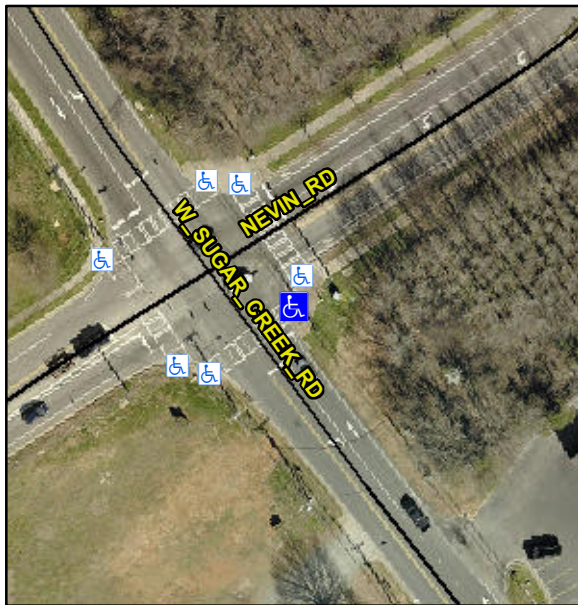

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.5	Yes	Ramp Slope (%)	7.8
Yes	Ramp Width (in)	48.5	No	Ramp XSlope (%)	3.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.5	N/A	Flare Slope RT (%)	10.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	81.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.5	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.1
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	113.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 2600.00

