


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 15094Main Street: ALBEMARLE\_RDCross Street: REDDMAN\_RDLocation:SWADA ID: 967EA1BD3025Ramp Type: PerpInitial Pass/Fail: FailOverall Compliance: NoSeverity Score: 33.75

**Codes/Mitigation Info/Possible Solution** 

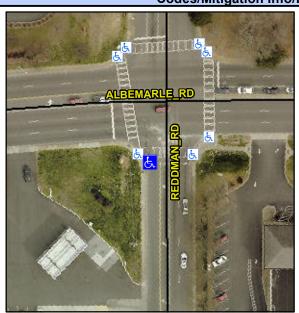

Street 1 Name	REDDMAN RD
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

-		
STATE OF	Possible Solutions:	9
The Park	Remove & Replace Entire Ramp.	ı
-		ı
		1
100		ı
		ı
1		ı
6	Surveyor Notes:	ı
	N/A	ı
		1
1		
7		
	PROW/ADA:	ı
1	Not Found, R304.5.1, R304.2.2,	1
-	R304.5.3	ı
		ı
		_
		ı

7	Ò



Total Cost:



1850.00

Field Measurements/Component Compliance							
Comp	liance Description	Data	Comp	liance Description	Data		
N/A	Ramp Length (in)	59.0	No	Ramp Slope (%)	11.5		
No	Ramp Width (in)	40.0	No	Ramp XSlope (%)	6.4		
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A		
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	8.7		X Walk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm Grate/Utility Type			
		N/A			N/A		
			Yes	Surface Condition? (G/P)	Good		