


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 12605	Main Street: KENSINGTON_DR	Cross Street: THE_PLAZA	Location: SE
ADA ID: 96D3E5551D28	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 10
			Field Measurements/Component Compliance

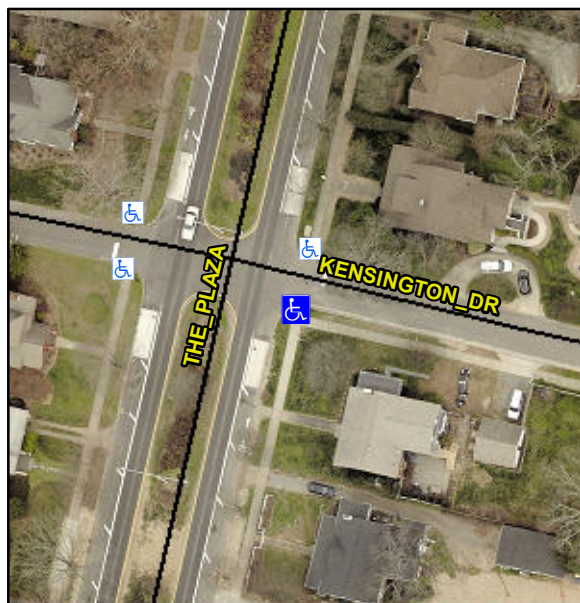

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.3, R305.1.4,
R305.2, R302.7.2**

Street 1 Name	KENSINGTON DR
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	99.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	63.0	No	Grade Break Slope (%)	5.5
Yes	Ramp Slope (%)	5.2	Yes	Grade Break XSlope (%)	1.4
Yes	Ramp XSlope (%)	0.4			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	61.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	65.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.9	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	13.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	4.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.1
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	3.1
N/A	Painted X Walk1?	No		Road Slope (%)	5.7
	X Walk 1 Direction	To N		Road X Slope (%)	4.6
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	5.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.6	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	18.0

