


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7486	Main Street: TRYON_ST	Cross Street: OWEN_ST	Location: NE
ADA ID: 971101BB7982	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 0
			Field Measurements/Component Compliance

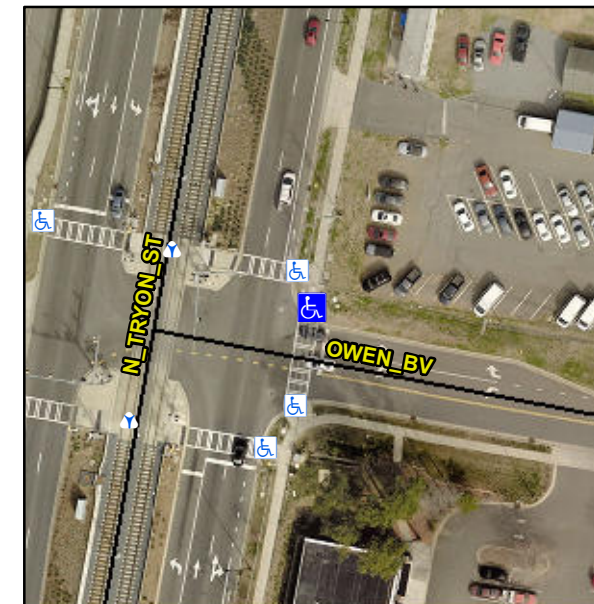

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

N/A

PROW/ADA:

R305.2

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	161.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	77.0	Yes	Grade Break Slope (%)	4.8
Yes	Ramp Slope (%)	8.0	Yes	Grade Break XSlope (%)	0.2
Yes	Ramp XSlope (%)	1.2			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	110.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	76.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	5.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	36.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	3.2
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.4
	X Walk 1 Direction	To S		Road X Slope (%)	4.0
	X Walk 1 Width (in)	119.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.0	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.0

