

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11974	Main Street: N_BREVARD_ST	Cross Street: E_11TH_ST	Location: N
ADA ID: 973E74BBB3D6	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 22.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

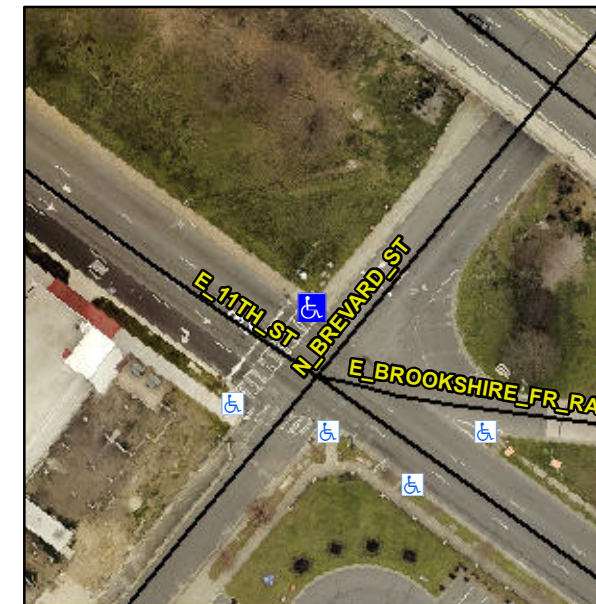

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R305.1.4, R305.2, R302.7, R302.7.2,
R304.5.4**

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	5.1
Yes	Ramp Width (in)	55.0	Yes	Ramp XSlope (%)	0.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.2	Yes	Flare Slope RT (%)	6.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	67.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	2.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	6.5
No	Gutter Lip Ht (in)	1.5	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	118.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name E 11TH ST
Stop Condition-Street 2 Signal
Street 2 Name N/A
Stop Condition-Street 1 N/A

