


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                                        |                                         |                        |
|-----------------------------------------|----------------------------------------|-----------------------------------------|------------------------|
| Intersection ID: 52608                  | Main Street: W_MALLARD_CREEK_CHURCH_RD | Cross Street: ALEXANDER_VILLAGE_MAIN_DR | Location: SW           |
| ADA ID: 97F147AF41B0                    | Ramp Type: BlendTrans2                 | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Severity Score: 0                       |                                        |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                                        | Field Measurements/Component Compliance |                        |

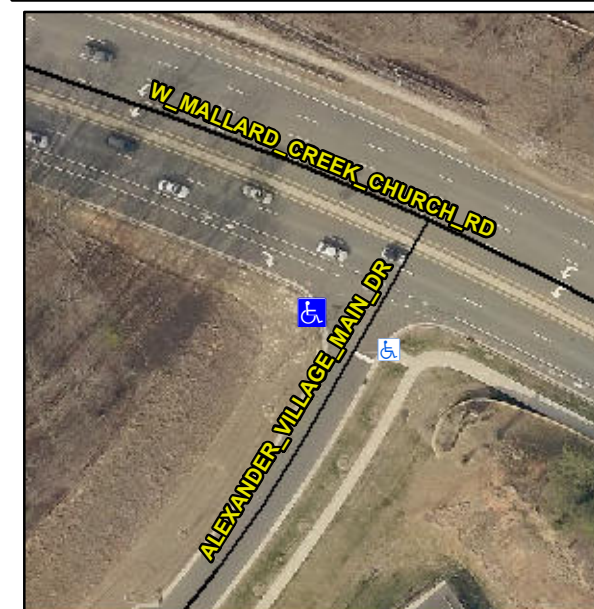

Possible Solutions:

**Remove & Replace Detectable Warning System. Remove & Replace Gutter.**

Surveyor Notes:

**NO SW**

PROW/ADA:

**R305.2, R304.5.3**

Total Cost: \$ 1550.00

| Compliance | Description           | Data                 | Compliance | Description                 | Data                 |
|------------|-----------------------|----------------------|------------|-----------------------------|----------------------|
| N/A        | Ramp Length (in)      | 107.0                | Yes        | BlendTrans Slope (%)        | 4.9                  |
| Yes        | Ramp Width (in)       | 68.0                 | Yes        | BlendTrans XSlope (%)       | 0.2                  |
| Yes        | Flare Type            | Curbed_NoWalkSurface | Yes        | Flare Type                  | Curbed_NoWalkSurface |
| N/A        | Flare Slope LT (%)    | N/A                  | N/A        | Flare Slope RT (%)          | N/A                  |
| N/A        | Flare Traversable LT? | No                   | N/A        | Flare Traversable RT?       | No                   |
| N/A        | Landing Length (in)   | N/A                  | Yes        | DWS Provided?               | Yes                  |
| N/A        | Landing Width (in)    | N/A                  | Yes        | DWS Contrast?               | Yes                  |
| N/A        | Landing Slope (%)     | N/A                  | Yes        | DWS Length (in)             | 24.0                 |
| N/A        | Landing X Slope (%)   | N/A                  | Yes        | DWS Full Width?             | Yes                  |
| N/A        | Landing Curb? (Y/N)   | No                   | No         | DWS Offset (in)             | N/A                  |
| N/A        | Shared Landing?       | No                   |            |                             |                      |
| Yes        | Gutter Ponding?       | No                   | Yes        | Gutter Slope (%)            | 1.7                  |
| Yes        | Gutter Lip Ht (in)    | 0.0                  | No         | Gutter X Slope (%)          | 3.9                  |
| N/A        | Painted X Walk1?      | No                   | N/A        | Painted X Walk2?            | N/A                  |
|            | X Walk 1 Direction    | To SE                |            | X Walk 2 Direction          | N/A                  |
|            | X Walk 1 Width (in)   | N/A                  |            | X Walk 2 Width (in)         | N/A                  |
|            | X Walk 1 Slope (%)    | 1.3                  |            | X Walk 2 Slope (%)          | N/A                  |
|            | X Walk 1 X Slope (%)  | 1.4                  |            | X Walk 2 X Slope (%)        | N/A                  |
| N/A        | Ramp inside XWalk1?   | N/A                  | N/A        | Ramp inside XWalk2?         | N/A                  |
|            | Road Slope (%)        | 1.4                  |            | Clear Space?                | Yes                  |
|            | Road X Slope (%)      | 1.3                  | N/A        | Clear Space to XWalk (in)   | N/A                  |
| Yes        | Any Obstructions?     | No                   | Yes        | Storm Grate/Utility Hazard? | No                   |
|            | Obstruction Type      |                      |            | Storm Grate/Utility Type    |                      |
|            |                       | N/A                  |            |                             | N/A                  |
|            |                       |                      | Yes        | Surface Condition? (G/P)    | Good                 |
|            |                       |                      | N/A        | Curb Slope (%)              | N/A                  |

Street 1 Name ALEXANDER VILLAGE MAIN DR  
 Stop Condition-Street 1 StopSign  
 Street 2 Name N/A  
 Stop Condition-Street 2 N/A

