


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 13086	Main Street: CENTRAL_AV	Cross Street: CLEMENT_AV	Location: SE
ADA ID: 980CDC03C77B	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 13.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length (in)	67.0	
			Yes	Ramp Width (in)	57.0	
			No	Ramp Slope (%)	9.1	
			Yes	Ramp XSlope (%)	2.6	
			N/A	Flare Type LT	N/A	
			N/A	Flare Slope LT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	
			N/A	Landing Length (in)	0.0	
			N/A	Landing Width (in)	0.0	
<p>Surveyor Notes:</p> <p><b>ACCESS AISLE RAMP</b></p> <p>PROW/ADA:</p> <p><b>R304.2.2</b></p>			N/A	Flare Slope RT (%)	0.0	
			N/A	Flare Traversable RT?	N/A	
			N/A	DWS Provided?	N/A	
			N/A	DWS Contrast?	N/A	
			N/A	DWS Length (in)	N/A	
			N/A	DWS Full Width?	N/A	
			N/A	DWS Offset LT (in)	N/A	
			N/A	DWS Offset RT (in)	N/A	
			N/A	Gutter Slope (%)	N/A	
			N/A	Gutter X Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	0.0	
			N/A	Painted X Walk1?	Yes	
				Road Slope (%)	5.9	
				Road X Slope (%)	3.0	
				Clear Space?	N/A	
			N/A	Clear Space to XWalk (in)	N/A	
			N/A	Storm Grate/Utility Hazard?	N/A	
			N/A	Storm Grate/Utility Type		
			N/A	Any Obstructions?	N/A	
				Obstruction Type		
			Yes	Surface Condition? (G/P)	Good	
			N/A	Curb Slope (%)	8.8	
Total Cost:		\$ 1600.00				

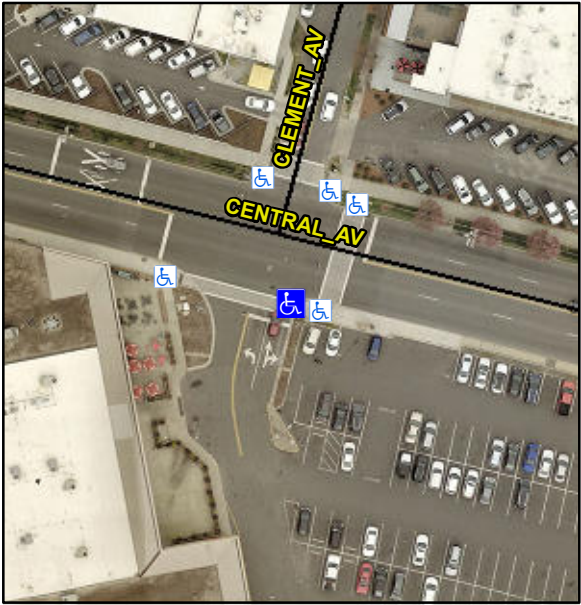