


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 49183	Main Street: ST_JOHN_LN	Cross Street: ST_STEPHEN_LN	Location: NW
ADA ID: 984E4290CA8E	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 10
			Field Measurements/Component Compliance

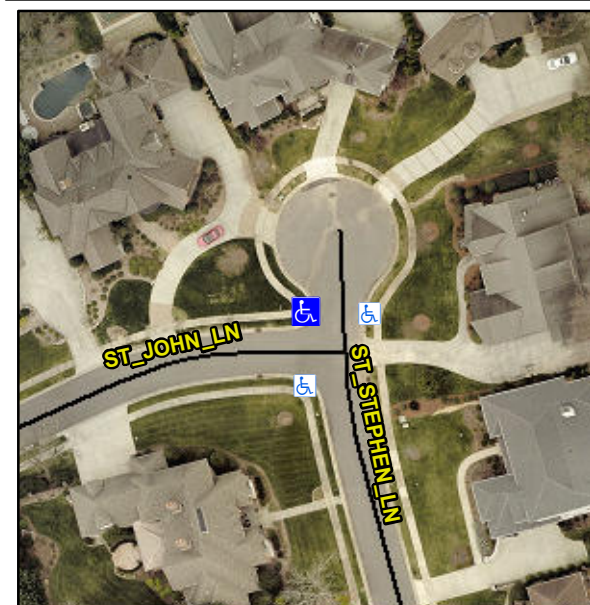

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**LT RP < 5%**

PROW/ADA:

**R304.5.1, R304.5.3**

Street 1 Name **ST JOHN LN**  
 Stop Condition-Street 1 **None**  
 Street 2 Name **ST STEPHEN LN**  
 Stop Condition-Street 2 **None**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	46.0	N/A	Ramp Length RT (in)	35.0
No	Ramp Width LT (in)	46.5	No	Ramp Width RT (in)	46.5
Yes	Ramp Slope LT (%)	3.7	Yes	Ramp Slope RT (%)	8.2
No	Ramp XSlope LT (%)	4.3	No	Ramp XSlope RT (%)	2.9
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	1.9
	X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	2.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.2	N/A	Clear Space?	N/A
	Road X Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.7

