


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 10747		Main Street: DUCKWORTH_AV		Cross Street: S_BRUNS_AV		Location:		E	
ADA ID: 98FC6D1256A7		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 12.5	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
		Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
		Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	97.0	N/A	Grade Break?	N/A
				Yes	Ramp Width (in)	69.0	N/A	Grade Break Slope (%)	0.0
				No	Ramp Slope (%)	9.9	N/A	Grade Break XSlope (%)	0.0
				Yes	Ramp XSlope (%)	0.9			
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
Surveyor Notes: N/A				N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
				N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
				N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No		Road Slope (%)	2.5
					X Walk 1 Direction	To W		Road X Slope (%)	3.6
					X Walk 1 Width (in)	N/A		Clear Space?	N/A
					X Walk 1 Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
PROW/ADA: R304.2.2					X Walk 1 X Slope (%)	3.6	N/A	Storm Grate/Utility Hazard?	N/A
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
				N/A	Any Obstructions?	N/A			N/A
					Obstruction Type		Yes	Surface Condition? (G/P)	Good
							N/A	Curb Slope (%)	8.8
Street 1 Name		DUCKWORTH AV							
Stop Condition-Street 1		StopSign							
Street 2 Name		N/A							
Stop Condition-Street 2		N/A							
Total Cost:		\$		1600.00					

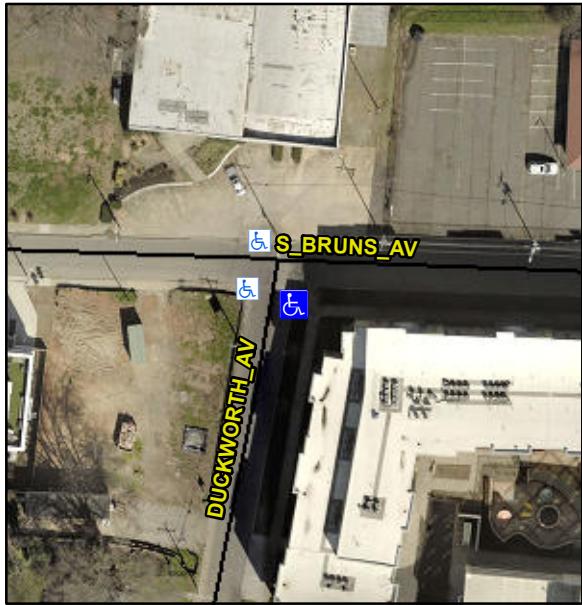