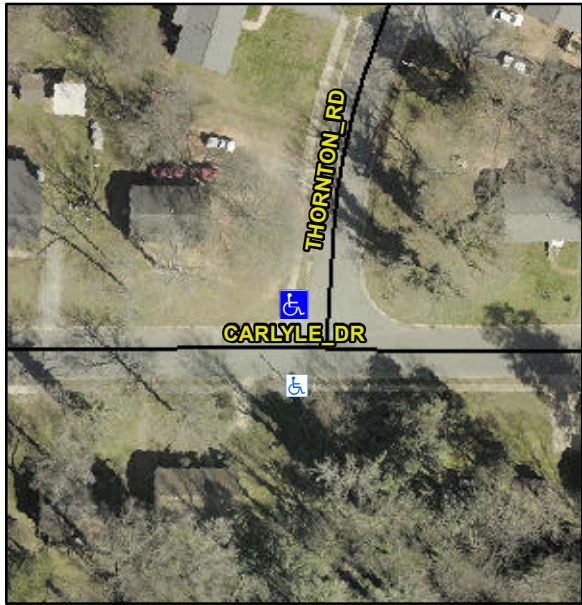


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11763	Main Street: CARLYLE_DR	Cross Street: THORNTON_RD	Location: NW
ADA ID: 99B9ED416CBE	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	49.0	Yes	Ramp Slope (%)	5.9
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	4.4	Yes	Flare Slope RT (%)	8.8
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	57.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	2.5	Yes	DWS Length (in)	24.0
			Yes	Landing X Slope (%)	2.0	Yes	DWS Full Width?	Yes
Surveyor Notes:	N/A		N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To S		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
PROW/ADA:	Not Found, R304.2.2-Perp, R304.3.2-Para			Road Slope (%)	N/A	N/A	Clear Space?	Yes
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
Street 1 Name		CARLYLE DR						
Stop Condition-Street 2		None						
Street 2 Name		N/A						
Stop Condition-Street 1		N/A						
Total Cost:		\$ 1850.00						

