


Intersection ID: 14294		Main Street: EAST_BV		Cross Street: EUCLID_AV		Location:		SE											
ADA ID: 99C4567E5FA9		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 13.75											
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance															
 <p>Street 1 Name EAST BV</p> <p>Stop Condition-Street 1 Signal</p> <p>Street 2 Name N/A</p> <p>Stop Condition-Street 2 N/A</p>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data			
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		71.0		N/A		Grade Break?		N/A		N/A	
						Yes		Ramp Width (in)		71.0		N/A		Grade Break Slope (%)		0.0		0.0	
						No		Ramp Slope (%)		9.0		N/A		Grade Break XSlope (%)		0.0		0.0	
						No		Ramp XSlope (%)		2.1									
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A		N/A	
						N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0		0.0	
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A		N/A	
						N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A		N/A	
						N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A		N/A	
Surveyor Notes:				Compliance		Description		Data		Compliance		Description		Data					
N/A				N/A		Flare Type RT		N/A		N/A		Flare Slope RT (%)		0.0					
				N/A		Flare Traversable RT?		N/A		N/A		DWS Provided?		N/A					
				N/A		DWS Contrast?		N/A		N/A		DWS Length (in)		N/A					
				N/A		DWS Full Width?		N/A		N/A		DWS Offset LT (in)		N/A					
				N/A		DWS Offset RT (in)		N/A		N/A		Gutter Slope (%)		N/A					
				N/A		Gutter X Slope (%)		N/A		N/A		Gutter X Slope (%)		N/A					
				N/A		Painted X Walk1?		Yes				Road Slope (%)		7.8					
				N/A		X Walk 1 Direction		To NE				Road X Slope (%)		1.6					
				N/A		X Walk 1 Width (in)		112.0				Clear Space?		N/A					
				N/A		X Walk 1 Slope (%)		7.8		N/A		Clear Space to XWalk (in)		N/A					
				N/A		X Walk 1 X Slope (%)		1.6		N/A		Storm Grate/Utility Hazard?		N/A					
				N/A		Ramp inside XWalk1?		Yes				Storm Grate/Utility Type							
				N/A		Any Obstructions?		N/A						N/A					
						Obstruction Type				Yes		Surface Condition? (G/P)		Good					
								N/A		N/A		Curb Slope (%)		5.1					
Total Cost:				\$		1600.00													

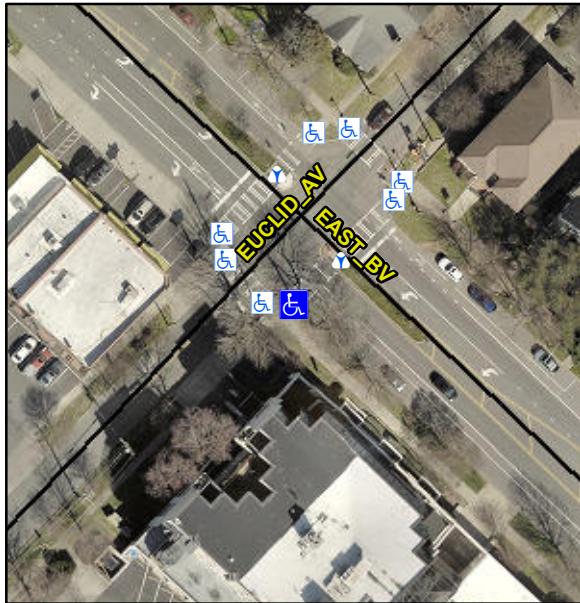