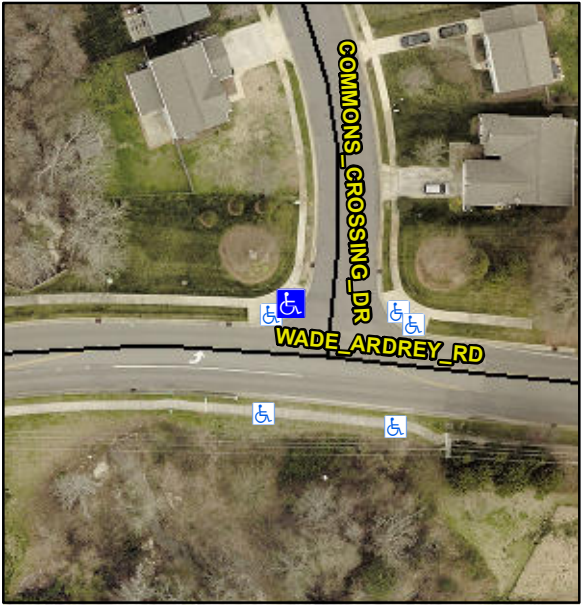


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28397	Main Street: COMMONS_CROSSING_DR	Cross Street: WADE_ARDREY_RD	Location: NW
ADA ID: 99D964147DAE	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	Compliance
	Remove & Replace Entire Ramp.		Description		Data	Description
			N/A	Ramp Length LT (in)	36.0	N/A
			Yes	Ramp Width LT (in)	60.0	Yes
			Yes	Ramp Slope LT (%)	4.0	Yes
			No	Ramp XSlope LT (%)	2.7	No
			N/A	Ramp Length (in)	68.5	Yes
			No	Ramp Width (in)	44.0	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
Surveyor Notes: LT RP < 5% PROW/ADA: Not Found, R304.5.1, R304.5.3			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
Street 1 Name Stop Condition-Street 1 Street 2 Name Stop Condition-Street 2				X Walk 1 Direction	To E	
				X Walk 1 Width (in)	N/A	
				X Walk 1 Slope (%)	5.0	
				X Walk 1 X Slope (%)	3.9	
				Ramp inside XWalk1?	N/A	N/A
				Road Slope (%)	N/A	N/A
				Road X Slope (%)	N/A	N/A
				Clear Space?	N/A	N/A
				Clear Space to XWalk (in)	N/A	N/A
				Any Obstruction?	N/A	N/A
Total Cost: \$ 1800.00				Obstruction Type		N/A
				Storm Grate/Utility Hazard?	N/A	N/A
				Storm Grate/Utility Type		N/A
				Surface Condition? (G/P)	Yes	Good
				Curb Slope (%)		14.1

