

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 18778	Main Street: E_INDEPENDENCE_BV	Cross Street: E_W_T_HARRIS_BV	Location: W
ADA ID: 99E421C55C11	Ramp Type: IslandPerp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

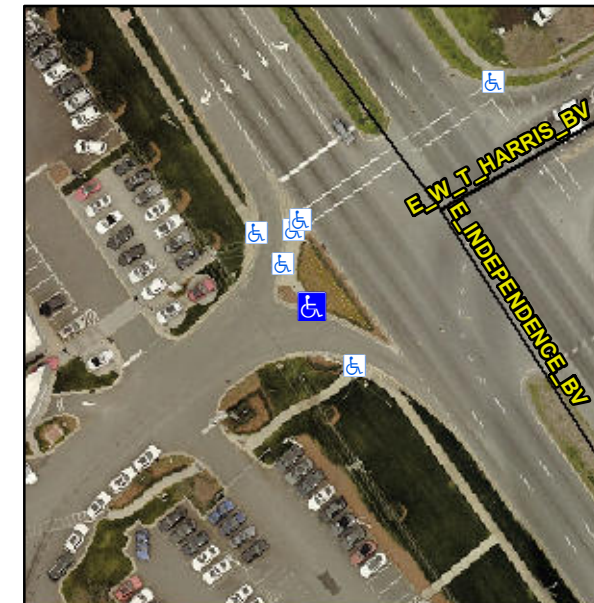

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R302.7**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.7
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	49.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.6	Yes	DWS Length (in)	25.0
Yes	Landing X Slope (%)	0.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	2.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3400.00

